

F/R
E-in-c (1)
28/7/20

28/7/20

EST. T.
for upload - cc web site
To A.C.I.E.
upload on website
sharma.
28/7/20

INSPECTION NOTE RECORDED BY Er.S.K.SHARMA
CHIEF ENGINEER (K.Z),HP.PWD.DHARAMSHALA

Name of work:- C/O Govt.Polytechnic building for Women at Rehan in Tehsil,Fatehpur,Distt.Kangra (HP)

Date of Inspection: 14/07/2020

Name of Inspection Officer: - Er.S.K.Sharma

Designation: - Chief Engineer (K.Z)

A/A & E/S:- Rs.42,61,10,000/-

Awarded amount:- Rs.24,87,96,641/-only

Date of Award:- 04.04.2018

Date of completion: - 18.04.2021

Accompanying officers: -
1.Er.M.P.Dhiman,S.E.9th Circle,HPPWD.Nurpur.
2.Er.Roshan Lal Attri, EE, HPPWD.Fatehpur Division.
3.Er.Ravinder Kandoria,A.E.HPPWD.Sub Divn.Rehan
4.Er.Sanjay Rattan,,HPPWD.Sub Divn.Rehan
Representative: Mattewal Co.op L/C Society Ltd.Amritsar IND.

2369
28/7/20

The said work was inspected by the undersigned alongwith all the above named Officers/officials. At the time of inspection of Admn.block, finishing work, form work of 3rd floor of academic work RCC slab was in progress. RCC work in Type-IV qtr. and Canteen block was in progress. During the course of the inspection, following observations/short comings were noticed.


The progress of execution of work by the contractor is very slow. Till now only 55% of the work has been completed. The stipulated date of completion of work is 18.04.2021.The Executive Engineer is directed to obtain the revised working programme from the contractor and ensure the completion of work by the said date, or else take action under the clause of agreement for not achieving the required mild stone, when the mentioned time . The preference should be given to complete the administrative block in all respects within two months.

Honeycombing has been noticed at certain locations, in administrative block and workshop block, which should be rectified and quality of concrete be improved. Further, form work & reinforcement has been placed and provided in the sloping slab which should be laid properly to avoid any leakage in future.

The columns of the Type-IV quarters are not in plumb line. The mid landing of the stair case is also deflected, these defects be rectified immediately.

The quality control register were not shown during the inspection, the same should be shown to the Superintending Engineer, 9th Circle within two days. The frequency of C.C.cubes sampling be ensured as per IS 456 and quality control register should be maintained properly. The locations, from where these samples have been taken be clearly mentioned in the quality control register henceforth.

The form work of columns beam joints in type-IV block had not been provided properly provided at certain locations and concrete cover on these joints was found on lesser side. Contractor is advised to be careful infuture while providing the form work in the column beam joints..


(S.K.Sharma)
Chief Engineer (KZ),
HP.PWD.Dharamshala.

Endst.PW/CE(KZ)/Insp.Note/2020-

1214-18

Dated: 18/7/20


Copy to The Principal Secretary (PW) to Govt. of H.P.Shimla for information.

Copy to the Engineer-in-Chief, HP.PWD.Nirman Bhawan, and Nigam Vihar Shimla for information please.

✓ Copy to the Engineer-in-Chief (Project), HPPWD.Nigam Vihar Shimla-171002 for information please.

Copy to the Superintending Engineer, 9th Circle HP.PWD.Nurpur for information and necessary action.

Copy to the Executive Engineer, HPPWD.Division Fatehpur for information and necessary action.


(S.K.Sharma)
Chief Engineer (KZ),
HP.PWD.Dharamshala.