

INSPECTION NOTE RECORDED BY Er.S.K.SHARMA
CHIEF ENGINEER (KZ),HP.PWD.DHARAMSHALA

Name of work:- Construction of Khairian to Bakan road Km.0/0 to 1/900 (Stage-II) (SH:-Passing Places, Retaining Walls Missing Cross drainage side drains Parapets, cement concrete pavement and Metalling/Tarring etc.including Routine maintenance for five years after completion of construction work under PMGSY(World Bank Batch-II) RRP-II 2018-19 Package No.HP-04-292).

Date of Inspection: 23.06.2020

Name of Inspection Officer: - Er.S.K.Sharma

Designation: - Chief Engineer (KZ)

A/A & E/S:- Rs.86.50 lacs (Part-I)+11.25 lacs (Part-II)

Awarded amount:- Rs.68.31 lacs (Part-I) 11.44 lacs (Part-II) Total=79.75 lacs

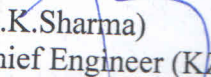
Date of Award:- 19.11.2019

Date of completion: - 28.08.2020

Accompany officers: - 1.Er.Jagtar Singh,Executive Engineer,HPPWD.Divn. Jawali
2.Er.Rajest Kumar,Assistant Engineer,Sub Divn.HPPWD.Kotla
3.Er.Yash Pal Singh,JE,Section Nadoli.
Representative: M/S Dinesh Construction Works Govt.Contractors

The said work was inspected by the undersigned alongwith all the above named Officers/officials. At the time of inspection, the work of laying of G-2 was in progress during the course of the inspection following observations/short comings were noticed.

- 1 Shoulders on both sides of the pavement have not been built and compacted simultaneously with the pavement layers.
- 2 Super elevations have not been found provided at number of locations on curves.
- 3 The edges of U-shape drain in 1st km are required to be raised to match the existing surface of the pavement with proper x-slope on shoulders.
- 4 The G-2 layer, though laid in full length has neither been water bound nor compacted properly. Adequate camber has also not been provided at number of locations. Henceforth the G-2 layer be properly water bound, compacted and laid with adequate cross slope/camber.
- 5 The road has been previously checked by the state quality monitor and graded as satisfactory as intimated by the Executive Engineer.However, quality of work be ensured at all stages of construction.w.r.to MORD specifications. The work is stipulated to be completed before 28.08.2020.Necessary efforts be made to complete the same within the said period.


(S.K.Sharma)
Chief Engineer (KZ),
HP.PWD.Dharamshala.

Endst.PW/CE(KZ)/Insp.Note/2020-

692-95

Dated: 27-06-2020


Copy to The Principal Secretary (PW) to Govt. of H.P.Shimla for information.

Copy to the Engineer-in-Chief, HP.PWD.Nirman Bhawan, and Nigam Vihar Shimla for information please.

✓ Copy to the Engineer-in-Chief (Project), HPPWD.Nigam Vihar Shimla-171002 for information please.

Copy to the Superintending Engineer, 9th Circle HP.PWD.Nurpur for information and necessary action.

Copy to the Executive Engineer, HPPWD.Division Jawali for information and necessary action.


(S.K.Sharma)
Chief Engineer (KZ),
HP.PWD.Dharamshala.